

HOOD RIVER COUNTY CORNER RESTORATION FORM

Section: 35/36 Township: 1 N Range: 10E

Date: 5/29/24

Corner Designation Z21

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc:

(1859) The U.S. General Land Office contracted with David P. Thompson, Deputy Surveyor, under contract No. 79, to survey the Baseline from the southeast corner of section 32 in T1N R8E to the southeast corner of T1N R32E, conducted May 21, 1859 through June 8, 1859. Thompson set "post for corner to Secs 35 & 36." References set:

- 20" Fir, N65W, 30 links
- 4" Fir, N42E, 32 links

(1879) The U.S. General Land Office contracted with Alonzo Gesner, Deputy Surveyor, under contract No. 336, signed August 13, 1879, to survey the exterior lines of T1N R10E. Gesner recovered the corner to sections 35 and 36 as "agreeing with notes." References found:

- 20" Fir, N65W, 30 links
- 4" Fir, N42E, 32 links

(1994) R.A. Morris surveyed the south lines of section 36 T1N R10E and section 31 T1N R11E, CS1994132, for the U.S. Forest Service, conducted October 1993 and October 1994. Morris set 2.5" aluminum pipe w/2.5" aluminum cap at proportional corner, marked "T1N R10E SC S35/S36 1994 RS401" References set:

- 13" D. Fir, N20E, 18.3', marked "T1N R10E SC36 BT"
- 13" D. Fir, N85E, 22.8', marked "T1N R10E SC36 BT" Set carsonite post West 1'

Monument(s) & Accessories Found:


(2024) S. Deshong of US Forest Service, Columbia Land Zone recovered corner monument as set in 1994. References found:

- 10" down/dead fir, N20W, 18.2', w/Bearing Tree tag posted by RM-CE 1994
- 22" D. fir, East 23.7', with healed blaze, placed 2" brass washer right side center, 1.3' high

Monument Detail

Found 2.5" aluminum pipe and cap, 1.5' high in collar of stone, leaning westward.

Sketch

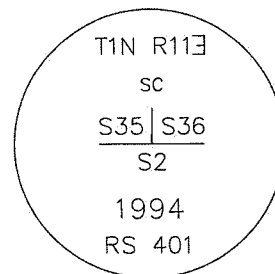

Monument Set (Procedures and Description)

Straightened and reset rock collar

New Accessories:


- 17" doug fir, N53E, 18.2', scribed "T1NR10ES36BT", w/2" washer right side center, 1.6' high
- Set 5/8" rebar w/Pink Plastic Cap "OR PLS89906", N45W, 10.0', 3.6" above ground, w/guard post, w/Land Survey Monument and Bearing Tree tags attached.

Location & Comments:

- Corner lies on steep westward slope, approximately 550' west from ridge top and the Bald Point Trail.
- Painted 6" red bands around Bearing Trees.

Compass Declination _____
 Firm/Agency USDA Forest Service
Gifford Pinchot National Forest, Columbia Lands Zone
 Address 987 McClellan Road
Vancouver, WA 98661
 Party Chief S. Deshong
 Notes _____
 Witness R. Ellis, C. Clark

Surveyor's Seal

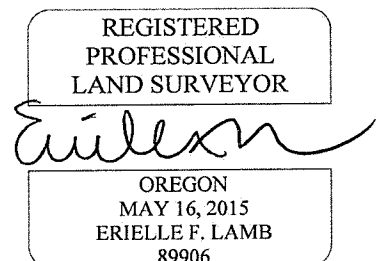

EXPIRES: 12/31/2024