

SECTION OR SUBDIVISION

TWP. ^{3N}2N, RANGE ¹⁰10, W.M.

CORNER No. 620

CORNER DESCRIPTION

ODOT RESET 2/14/02

Cor#620 Sec Cor 35,36,1,2 3N/2N R10E

This corner has no direct ties to the GLO corner. ODOT monumented a found spike in 2002 by setting a 5/8" rod with 1 1/2" brass cap. This position has been used extensively since the 1960's and any attempt at moving it would create many more problems than it would solve.

W.O. REF. STEP BACK

ORIGINAL IN 3N1036

NARRATIVE FILE

CARD 2 OF 2


Monument(s) & Accessories Found: (Condition & Source)

Found in A.C., iron nail 2 1/4 inch long with 5/8 inch head. Dimple mark on one side. Shaft heavily rusted.
No accessories.
Unknown origin. Called on ODOT r/w map 8B-36-13.

Set monument Detail:

5/8 inch iron rod with 1 1/2 inch brass cap. Cap stamped as shown.

Sketch of set monument:

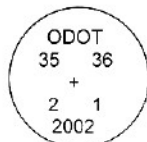

Monument Set (Procedures and Description):

Original nail position was preserved by cross-ties in 2 directions. A search was made for earlier set monuments by excavating a one foot wide by one foot deep hole through A.C. to rock surface. New monument set using same cross-ties. Set 5/8 inch by 30 inch iron rod with 1 1/2 inch brass cap stamped as shown.

New Accessories: Set monument in an iron monument box. "ODOT" is cast in lid of box.

Set 1.17 inch brass disc in concrete curb NE. of corner monument, N. side of pedestrian ramp. 14.390 m at Az. 50-34-35

Set 1.17 inch brass disc in concrete curb SE. of corner monument, 1.2 m W. of water valve. 13.659 m at Az. 122-20-40

Set 1.17 inch brass disc in concrete SW. of corner monument, near center E. side of concrete inlet wall. 17.957 m at Az. 211-50-45.


Set 1.17 inch brass disc in concrete curb NW. of corner monument, W. side of pedestrian ramp. 14.096 m at Az. 297-12-28

All 1.17 inch brass discs are stamped "ODOT RP" with center hole.

Basis of bearing N 0-07-00 E from set Sec. corner monument to 1/4 corner of Sections 35 and 36, T. 3N., R. 10E.

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Hood River County Surveyor's Office

Rec'd 3-15-02 0700
CC0620

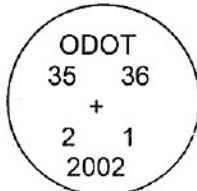SECTION 36	TOWNSHIP 3N	RANGE 10E
COUNTY: Hood River		DATE 12 February, 2002
CORNER DESIGNATION: <i>SE</i> section corner <i>SW " " 36 3-12-02</i>		(Please check one) <input type="checkbox"/> Condition Report Only <input type="checkbox"/> Not Found <input checked="" type="checkbox"/> Renewed <input type="checkbox"/> Unrecorded <input type="checkbox"/> Surveyed In <input type="checkbox"/> Referenced Out
Previous Renewals / Surveys, etc. NA		
Monument(s) & Accessories Found: (Condition & Source) Found in A.C., iron nail 2 1/4 inch long with 5/8 inch head. Dimple mark on one side. Shaft heavily rusted. No accessories. Unknown origin. Called on ODOT r/w map 8B-36-13.		
Set monument Detail: 5/8 inch iron rod with 1 1/2 inch brass cap. Cap stamped as shown.	Sketch of set monument: <div style="text-align: center;">  </div>	
Monument Set (Procedures and Description): Original nail position was preserved by cross-ties in 2 directions. A search was made for earlier set monuments by excavating a one foot wide by one foot deep hole through A.C. to rock surface. New monument set using same cross-ties. Set 5/8 inch by 30 inch iron rod with 1 1/2 inch brass cap stamped as shown.		
New Accessories: Set monument in an iron monument box. "ODOT" is cast in lid of box. Set 1.17 inch brass disc in concrete curb NE. of corner monument, N. side of pedestrian ramp. 14.390 m at Az. 50-34-35 Set 1.17 inch brass disc in concrete curb SE. of corner monument, 1.2 m W. of water valve. 13.659 m at Az. 122-20-40 Set 1.17 inch brass disc in concrete SW. of corner monument, near center E. side of concrete inlet wall. 17.957 m at Az. 211-50-45. Set 1.17 inch brass disc in concrete curb NW. of corner monument, W. side of pedestrian ramp. 14.096 m at Az. 297-12-28 All 1.17 inch brass discs are stamped "ODOT RP" with center hole. Basis of bearing N 0-07-00 E from set Sec. corner monument to 1/4 corner of Sections 35 and 36, T. 3N., R. 10E.		
Location & Comments: Intersection of Hood River Hwy. 281 and Brookside Dr.		Compass Declination:

Firm / Agency Oregon Dept. of Transportation
123 NW. Flanders
Portland, OR 97209


SURVEYOR'S SEAL

<input type="checkbox"/>	Unrecorded
<input type="checkbox"/>	Surveyed In
<input type="checkbox"/>	Referenced Out

Previous Renewals / Surveys, etc.
NA

Monument(s) & Accessories Found: (Condition & Source)
Found in A.C., iron nail 2 1/4 inch long with 5/8 inch head. Dimple mark on one side. Shaft heavily rusted.
No accessories.
Unknown origin. Called on ODOT r/w map 8B-36-13.

Set monument Detail:
5/8 inch iron rod with 1 1/2 inch brass cap. Cap stamped as shown.

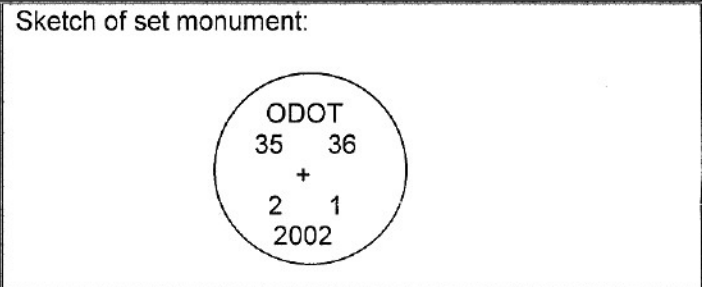

Monument Set (Procedures and Description):
Original nail position was preserved by cross-ties in 2 directions. A search was made for earlier set monuments by excavating a one foot wide by one foot deep hole through A.C. to rock surface. New monument set using same cross-ties. Set 5/8 inch by 30 inch iron rod with 1 1/2 inch brass cap stamped as shown.

New Accessories: Set monument in an iron monument box. "ODOT" is cast in lid of box.
Set 1.17 inch brass disc in concrete curb NE. of corner monument, N. side of pedestrian ramp. 14.390 m at Az. 50-34-35
Set 1.17 inch brass disc in concrete curb SE. of corner monument, 1.2 m W. of water valve. 13.659 m at Az. 122-20-40
Set 1.17 inch brass disc in concrete SW. of corner monument, near center E. side of concrete inlet wall. 17.957 m at Az. 211-50-45.
Set 1.17 inch brass disc in concrete curb NW. of corner monument, W. side of pedestrian ramp. 14.096 m at Az. 297-12-28
All 1.17 inch brass discs are stamped "ODOT RP" with center hole.
Basis of bearing N 0-07-00 E from set Sec. corner monument to 1/4 corner of Sections 35 and 36, T. 3N., R. 10E.

Location & Comments:
Intersection of Hood River Hwy. 281 and Brookside Dr.

Compass Declination:

Firm / Agency Oregon Dept. of Transportation
123 NW. Flanders
Portland, OR 97209

Party Chief
Jeff Berscheid
Brian Gigstad

Notes

Witness Randy Johnston
Hood River Co. Surveyor

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Brian P. Tandy

OREGON
JULY 7, 1903
BRIAN P. TANDY
2222

RENEWS 6-30-02