

A DEPENDENT RESURVEY of the  
SE.1/4 NW.1/4 of SECTION 9, TIS RIOE, W.M.  
for Weyerhaeuser Columbia Timberlands  
as situated within  
HOOD RIVER COUNTY, OREGON

JULY 30, 2015

HOOD RIVER COUNTY  
SURVEYOR'S OFFICE

Survey No. 2015-041

Filed 10/7/15

By BC

**NW.1/16 CORNER**

Fd. 1/2" rebar with yellow plastic cap stamped LS-1028. (See SR-1,2)

**FOUND REFERENCES**  
-STEEL FENCE POST EAST-1.0'

**NEW REFERENCES**  
-10" FIR SCRIBED (X),(BT) N12°E-38.8'  
-12" FIR SCRIBED (NW.1/16 S9BT) N88°E-9.4'  
-6 FOOT STEEL FENCE POST W/BT TAG SOUTH-2.0'

(N89°07'22"E-1249.61' SR-2)  
(S89°44'37"E-1249.36' SR-1)  
S 89°43'32" E - 1249.36'

**CN.1/16 CORNER**

Calculated position per SR-1. Posted lines to South & West.  
Fd. 5/8" rebar w/2-1/2" stamped aluminum cap S17°54'27"W-22.3' from Calculated CN. 1/16 corner, along with 2 references (See SR-1) Not accepted for Point on Line.



SE.1/4 NW.1/4  
LONGVIEW TIMBERLANDS, LLC  
36.36 AC±

(N0°14'34"W-1249.83' SR-2)  
(N00°06'35"W-1249.56' SR-1)  
N 00°03'51" W - 1249.56'



**BASIS OF BEARING**  
Between the previously recorded NW.1/16 and SW.1/16 corners (See SR-1)

**NARRATIVE**

The purpose of this survey was to mark the North, West and East lines of the SE.1/4 NW.1/4 and a portion of the West line of the NE.1/4 SW.1/4 of Section 9, TIS RIOE, as previously surveyed and filed as CS-2001 036 and CS-1985 017. A closed traverse was run around the property, between existing corners of record, as shown hereon, with a Leica "TC1203" (least read = 3"), obtaining a relative error of closure of better than 1:10,000. The above said lines were then marked with 1/2" x 6" white fiber glass rods, painted blazes and flagging, per Weyerhaeuser Columbia Timberlands (owner of Longview Timberlands, LLC), specifications. The inverted bearing between the NW.1/16 and the SW.1/16 corners, as previously determined on the above said surveys, was used for the basis of bearing for this survey. The CW.1/16 corner was then calculated at the position determined on survey "CS-2001 036" and set as shown hereon. During survey "CS-2001 036", the CN.1/16 corner could not be set due to a steep cliff. At that time a witness corner was set 20' South, from which 2 references were made. During this survey, the witness corner was found to be out of position as shown hereon.

**BASIS OF BEARING (INVERSE)**  
(N 00°28'54"E - 2669.32' SR-1)  
(N 00°28'53"W - 2661.04' SR-2)  
N 00°28'54" E - 2669.31'

(N87°48'03"E-1257.12' SR-2)  
(N88°56'04"E-1256.86' SR-1)  
N 88°56'23" E - 1256.86'



NE.1/4 SW.1/4  
LONGVIEW TIMBERLANDS, LLC

**C.1/4 CORNER**

Fd. 5/8" rebar w/2-1/2" stamped aluminum cap. (See SR-1)

**FOUND REFERENCES**  
-STEEL FENCE POST NORTH-1.0'

-12" FIR WITH TAG N1°E-13.9'  
-16" FIR WITH TAG S36°W-6.7'

**NEW REFERENCES**  
-10" FIR SCRIBED (X),(BT) S69°E-15.0'

**CW.1/16 CORNER**

Set 5/8" rebar with yellow plastic cap stamped "HAMPSTUR CORP. LS-2069". (See SR-1,2)

**FOUND REFERENCES**  
-STEEL FENCE POST TO NE-11'


**NEW REFERENCES**  
-14" FIR SCRIBED (CW.1/16 S9BT) N62°E-15.5'  
-22" FIR SCRIBED (X),(BT) S43°E-33.5'  
-6" STEEL FENCE POST SOUTH-1.0'

**SURVEY REFERENCES**

- 1) Refer to the 2001 survey performed under the direction of Anthony Klein, PLS-0932, file as CS-2001 036.
- 2) Refer to the 1985 survey performed under the direction of Danny Cron, PLS-1028, file as CS-1985 017.

**LEGEND**

- = A corner FOUND or SET during a previous survey, as described, tied this survey in July, 2015.
- = A new corner SET during this survey, on 7/23/2015, consisting of a 5/8"x30" rebar with yellow plastic survey cap, stamped "HAMPSTUR CORP. LS 2069"
- = A corner calculated only--not set this survey
- ( ) = A Bearing and/or Distance of record
- SR [X] = Survey Reference No.
- ▬▬▬ = A line marked during this survey with 1/2" x 72" white fiberglass rods, painted blazes and ribbon.

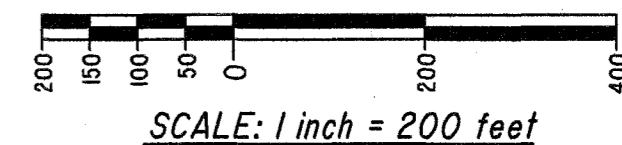

**SW.1/16 CORNER**

Fd. 1/2" rebar with yellow plastic cap stamped LS-1028. (See SR-1,2)

**FOUND REFERENCES**  
-STEEL FENCE POST WITH TAG, NORTH-1.0'  
-STEEL FENCE POST TO NW-1.0'

N 00°40'59" E - 1381.13'  
(N00°43'28"E-1380.82' SR-1)  
(N00°28'53"W-1382.24' SR-2)

ASSESSOR'S MAP: IS-10E-09

REGISTERED PROFESSIONAL LAND SURVEYOR  
*Calvin J. Hampton*  
SIGNED: 7/23/2015  
OREGON  
DECEMBER 2, 1983  
CALVIN J. HAMPTON  
2069  
EXPIRES: 6/30/2017

**HAMPSTUR CORPORATION**

Calculated by : PRG/TLG  
Checked by : CJH/PRG  
Drawn by : TLG  
Completion date : 7/23/2015  
Field Book no. : PS-694  
Drawing No. : 15-630.DWG  
HAMPSTUR JOB no. : 15-630  
Sheet no. 1 of 1