

1/4 CORNER COMMON TO 19 & 20

FOUND 1" IRON PIPE WITH CAP SET FROM ORIGINAL EVIDENCE HOOD RIVER CORNER CARD NO. 917

SECTION CORNER COMMON TO 16, 17, 20 & 21

FOUND 1" IRON PIPE WITH LEAD CAP SET FROM ORIGINAL EVIDENCE HOOD RIVER COUNTY CORNER CARD NO. 4

NARRATIVE

THIS SURVEY WAS PERFORMED FOR THE HOOD RIVER COUNTY FORESTRY DEPARTMENT IN ORDER TO MARK THE WEST AND SOUTH LINES OF THE N.E.1/4 OF SECTION 28, TWP. 1 NORTH, RANGE 11 EAST, W.M. SEVERAL CORNERS IN THIS SECTION WERE LOST, AND NEEDED TO BE REESTABLISHED BY PROPORTIONATE METHODS.

A 1979 SURVEY (COUNTY SURVEY NO. 80000) BY DAN CRON HAD PREVIOUSLY CALCULATED MOST OF THE CORNERS NEEDED. WE RETIED THE NECESSARY CORNERS AND DETERMINED THAT THE PROPORTIONING DONE BY CRON IN 1979 WAS CORRECT.

THE N.E. CORNER OF SECTION 28 HAS BEEN A SOURCE OF CONTROVERSY FOR THE LAST 10 YEARS. LARRY BISHOP, L.S. NO. 896 FOUND A STONE IN 1983 MARKED WITH THE PROPER GROOVES. THE STONE WAS LYING LOOSE ON THE GROUND. NO SIGNS OF ANY ORIGINAL WITNESS TREES WAS FOUND. I HAVE SEARCHED THE AREA AROUND THIS CORNER SEVERAL TIMES WITH NO SUCCESS. THERE ARE MANY LARGE STUMPS AND SNAGS IN THIS AREA OLD ENOUGH TO BE ORIGINAL, BUT THERE ARE NO MARKS ON ANY OF THEM AND NONE FIT THE STONE. I DECIDED TO USE DLC'S PROPORTIONATE POSITION FOR THIS CORNER. THE WEST AND SOUTH LINES OF THE N.E.1/4 OF SECTION 28 WERE BLAZED, AND ALL FOUR CORNERS OF THE N.E.1/4 WERE MONUMENTED.

Richard J. Arnold
COUNTY SURVEYOR

1/4 CORNER COMMON TO 19 & 30

FOUND 2" IRON PIPE WITH BRASS CAP IN MOUND OF STONES SET FROM ORIGINAL EVIDENCE HOOD RIVER CORNER CARD NO. 721

SECTION CORNER COMMON TO 19, 20, 29 & 30

CALC. POSITION AS PER DOUBLE PROPORTION CORNER NOT SET

SECTION CORNER COMMON TO 29, 30, 31 & 32

FOUND 1 1/2" IRON PIPE WITH BRASS CAP SET FROM ORIGINAL EVIDENCE HOOD RIVER COUNTY CORNER CARD NO. 363

1/4 CORNER COMMON TO 28 & 29

SET 1 1/2" IRON PIPE WITH BRASS CAP FROM ORIGINAL EVIDENCE FOUND 1" IRON PIPE WITH LEAD CAP APPROX. N.20°W., 50'+/- HOOD RIVER COUNTY CORNER CARD NO. 22

FILED


Richard J. Arnold
COUNTY SURVEYOR

REGISTERED PROFESSIONAL LAND SURVEYOR

Richard J. Arnold

OREGON
JULY 15, 1983
RICHARD J. ARNOLD
2038

Sept. 1992

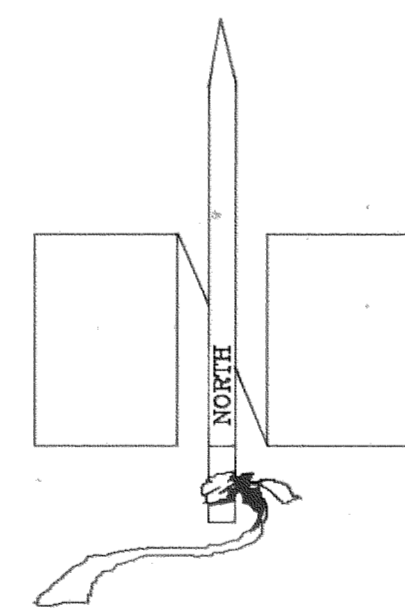

SCALE 1"=400
ASSUMED BASIS OF BEARING

HOOD RIVER COUNTY SURVEY T.1N.,R.11E.,W.M. SECTION 28 HOOD RIVER COUNTY, OREGON

S. 1/4 CORNER 28
FOUND 1" IRON PIPE WITH LEAD CAP HOOD RIVER COUNTY CORNER CARD NO. 18

SECTION CORNER COMMON TO 27, 28, 33 & 34
FOUND 1 1/2" IRON PIPE WITH LEAD CAP SET FROM ORIGINAL EVIDENCE HOOD RIVER COUNTY CORNER CARD NO. 38