


SECTION OR SUBDIVISION

CORNER No. 186

TWP. 15, RANGE 9 & 10 E, W.M.

CORNER DESCRIPTION

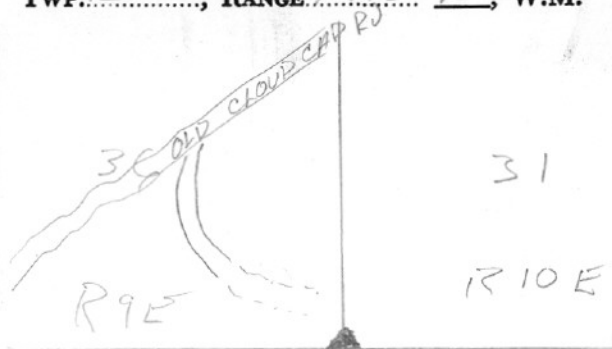

I.P. WIRASS CAP.

1940 (GLO)??

FOUND C.I. MARTIN 7/57

W.O. REF. _____

CARD OF

C 0186

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
HOOD RIVER County Surveyor's Office

SECTION 36	TOWNSHIP 1 SOUTH	RANGE 9 EAST
-----------------------------	-----------------------------------	-------------------------------

COUNTY: HOOD RIVER **DATE:** SEPT 24, 2009

CORNER DESIGNATION: Z-25

Southeast Section Corner of Sec 36

(Please check one)	
<input type="checkbox"/>	Condition Report Only
<input type="checkbox"/>	Not Found
<input type="checkbox"/>	Renewed
<input type="checkbox"/>	Unrecorded
<input type="checkbox"/>	Surveyed In
<input type="checkbox"/>	Referenced Out

Previous Renewals / Surveys, etc. Original:
 GLO Surveyor Newton Clark set this corner in 1884, common to T1 & 2S, R9 & 10E, and marks 4 bearing trees.
 A 10" Fir bears N55 °E, 39 lks (25.74 ft) marked "T1S R10E S31 BT".
 A 14" Cedar bears S85°E, 60 lks (39.6 ft) marked "T2S R10E S6 BT".
 A 16" Cedar bears S55°W, 78 lks (51.48 ft) marked "T2S R9E S1 BT".
 A 36" Cedar bears N85°W, 53 lks (34.98 ft) marked "T1S R9E S36 BT".
 GLO Surveyor Fred Mensch sets the closing corner for Sec 1 & 6 and changes this corner to T1S, R9 & 10E, only.
 GLO Surveyor Leonard Carter set a 3 ft iron post with brass cap in 1940, and calls the two northern BT's.
 In 1981, Danny Cron, PLS#1028, found corner of record as noted in CS#81087.
 In 1983, Larry Bishop, PLS#896, finds brass cap and 4 BT's and establishes a new BT, a 46" D.Fir bears N72°E, 44.0 ft. and scribed it "T1S R10E S31 BT".
 On 8/5/09, Berta Romio, USFS, found brass cap and 4 live bearing trees.

Monument(s) & Accessories Found: (Condition & Source)
 On September 24, 2009, Tim Rouse, Fred Thomas, and Don Karsch found the 1940 GLO 3" brass cap, 6" above ground, in good condition. The NE GLO BT is gone. Bishop's NE D.Fir BT is now a 41" Fir, with partially healed face & scribing visible, bears N71°E, 44.0 ft. The SE GLO BT is now a 22" Cedar with healed face, bears S82°E, 42.7 ft. The SW GLO BT is now a 33" Cedar with healed face, bears S49 ½ °W, 48.4 ft. The NW GLO BT is now a 42" Cedar with healed face, bears N55°W, 33.8 ft.

Monument Detail:
 1940 Brass Cap is Stamped:
T1S
R9E | R10E
S36 | S31
T2S R9E S1
1940

Sketch:

Monument Set (Procedures and Description):
 No new monument set. We surveyed, cleared, blazed, and marked the south line of Section 36, with orange carsonite posts, for the U.S. Forest Service.

New Accessories:
 No new accessories established. All four bearing trees found are alive and in good shape.

Location & Comments: Corner is +- 1/2 mi. west of Cooper Spur Road. Corner is on east slope, south of drainage, with large cedar and fir trees. Distances to bearing trees are to a nail at side center. All bearing trees have a "54-3 BT" sign nailed on the front and a "54-9 Land Survey Monument" sign nailed to the back, and a 6" orange painted band.

Firm / Agency:
 ROUSE SURVEYING, INC.
 Address: 4900 NE 229TH St, Ridgefield, WA 98642

Party Chief: Timothy P. Rouse, Oregon PLS #2799

Notes:

Witness: Fred Thomas, Oregon PLS #1018
 Don Karsch, Oregon PLS #1946

Compass Declination:
 Staff compass with Mag Dec of 16°E

SURVEYOR'S SEAL