SECTION OR SUBDIVISION	Corner No. 268
TWP. 15, RANGE 10 E, W.M.	Corner Description
== 33 = 4	BASALT STONE + DN TOP W.FIR 8" N 48° E 18" D.FIR 14" N 16" W 30"
1000	This corner removumented in 1978 by Lorry
The second secon	see back
W.O. Ref. 2000	
	CARD OF

Description of monument and accessories I established to perpetuate the original location of this corner

Set 2% Brass Cap on a 2% x 30" Galvanized Iron Pipe in a mound of stone-Buried stone upside down next to monument set. 16" White Fir N 11 E -14.1 feet scribed T1S R10 E S 34 upper blaze and a lower blaze scribed BT and with a 3/4" Brass Disk stamped LS 896 Set Guard Post East with U.S.F.S. sign 54-4 and added U.S.F.S. BT signs and red paint to 3 BT's

I hereby certify the above corner re-established as herein described on Sept. 5, 1979 Brass Cap Marked

TIS RIOE

93

2S 1979

PLS 896

PROFESSIONAL LAND SURVEYOR

GREGON LARRY D. ISHOP. 896

0111	County	Surveyor		Hood	Rive
Uffice of	ocurry.	Day to Joi	. County of	Hood	112.00

State of Oregon , I hereby certify that the within instrument was filed in this office

for percent on the day of the formation of the day of the formation of the

DEPUTY

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Deputy Newton Clark set a 4' x 4" post in 1884 and marked 16" Black Pine N58 E- 8 LKS.
20" Black Pine S10 E-13 LKS.
4" Willow S40 W- 30 LKS.
4" Fir N8 W- 8 LKS.

Re-established in its original position by Deputy Fred Mensch in 1912 Set Basalt stone 12 \times 10 \times 8 ins. with 3 grooves on E & W

edges and marked

6" Fir N68 E - 30 LKS.

6" Fir N34W - 8 IKS.

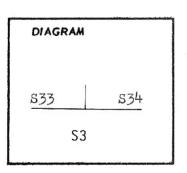

Description of corner evidence found:

Stone broken in pieces "X" on top approx. 12 x 10 x 8 grooves indistinct. 51.55 East of stone at C.C. S33

S4 SE

Orig. 6" Fir now 8" Wh. Fir no evidence of being previously scribed N 34 W 5.3 feet Orig. 6" Fir now 12" Wh. Fir stump badly rotted but with scribing visible N 68 E 19.8 feet

Description of monument and accessories I established to perpetuate the original location of this corner

Set 2½" Brass Cap on a 2½" x 30" Galvanized Iron Pipe in a mound of stone-Buried stone upside down next to monument set.

16" White Fir N 11 E -14.1 feet scribed T1S R10 E S 34 upper blaze and a lower blaze scribed BT and with a 3/4" Brass Disk stamped LS 896

Set Guard Post East with U.S.F.S. sign 54-4 and added U.S.F.S. BT signs and red paint to 3 BT's

I hereby certify the above corner re-established as herein described on Sept. 5, 1979

T1S R10E

Brass Cap Marked

T2S 1979 PLS 896

PROFESSIONAL LAND SURVEYOR DE BURNEYOR DE

GREGON LARRY D. BISHOP 896

Office of County Surveyor	County of	Hood Ri	ver
State of Oregon , I hereby certif	fy that the within	instrument wa	s filed in this office
for record on the day of	.,		
(COUNTY OFFICIAL)	by		
(COUNTY OFFICIAL)		(DEPUTY)	