

IN THE SE 1/4 SEC 33
T3N, R10E, W1M
HOOD RIVER CO.
OREGON

EXISTING BOUNDARY AGREEMENT
402.49 587' 31' 05"

BOUNDARY LINE LOT 22 PER PLAY (PROPORTIONATE)

402.49 587' 31' 05"

402.49 587' 31' 05"

LOT 22

TOWN OF
BELMONT

REGISTERED
OREGON
LAND SURVEYOR

Anthony C. Klein

JULY 17, 1970
ANTHONY C. KLEIN
932

LOT 21

100' 0"

ED MAIL
SE 1/4 SEC 33

FILED

REE TENNESON SURVEY # 4175


NOV 18 1971

Cayton Low Elaberg
COUNTY SURVEYOR

By _____
DEPUTY

#10

DATE	11/5/71	BY	A. Klein
TIME	3:46	BY	A. Klein
DATE	11/5/71	BY	A. Klein
TIME	7:27Z	BY	A. Klein

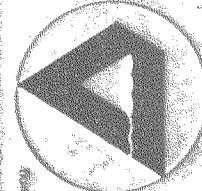

Dielschneider
Associates Inc
No. 8 Fourth St.
Hood River, Oregon 97031

SURVEY FOR
DONALD MUTH

KEE

Engineering

Surveying

Data Processing

**Dielschneider
Associates Inc**

No. 8 Fourth St. Hood River, Oregon 97031

Phones: Hood River 503/386-2912, The Dalles 503/296-3721



5 November 1971

FIELD NOTES:

FOR: Donald Muth, Project #71272, the North 104 feet of Lot 22, Town of Belmont, in the Southeast one-quarter of Section 33, Township 3 North, Range 10 East of the Willamette Meridian, Hood River County, State of Oregon.

CREW: Anthony Klein - Party Chief
Jim Robinson - Instrumentman
Leroy Daley - Chainman

DATE COMPLETED: November 5, 1971

Mrs. Donald Muth requested that our firm survey and set the corners of the North 104 feet of Lot 22, Town of Belmont. She furnished us with a boundary agreement for the North boundary of Lot 22 that was recorded May 31, 1904.

A research of our records found our survey of Lot 20, Town of Belmont, Project #71265 and a survey by Tenneson Engineering W.O. #4175. These surveys were used to determine the North boundary of Lot 20 according to the plat dimension.

Then we tried to locate the iron pipes that were mentioned in the boundary agreement but had no success. The agreement also mentioned a rock wall, the center of which is the North boundary. A rock wall was found but it only existed along the east 150 feet of the boundary mentioned. An iron pipe was set at the center of this rock wall on the East boundary of Lot 22. The line was then projected West along the center of the rockwall as best could be determined and made to intersect the right of way centerline of Country Club Road at a 90° angle. Aerial photographs of the area were reviewed to determine if the line, as was set, was the intention of the agreement. One photograph was from a flight in 1969 and the other was of an earlier date (not known). The earlier picture showed a rock wall that extended along the complete North boundary.

From all information obtained, the line, as set, is the intended North boundary of Lot 22 according to the agreement.

Basis of bearing is the centerline of Country Club Road as established by Tenneson Engineering W.O. #4175.

All corners found and established during the course of this survey together with measured angles and distances are shown on the attached map, which by reference is a part hereof.

Signed




Anthony C. Klein
Oregon Registered Land Surveyor
No. 932

REGISTERED
OREGON
LAND SURVEYOR

JULY 17, 1970
ANTHONY C. KLEIN
932

FILED

NOV 18 1971

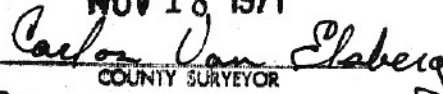

By _____
DEPUTY