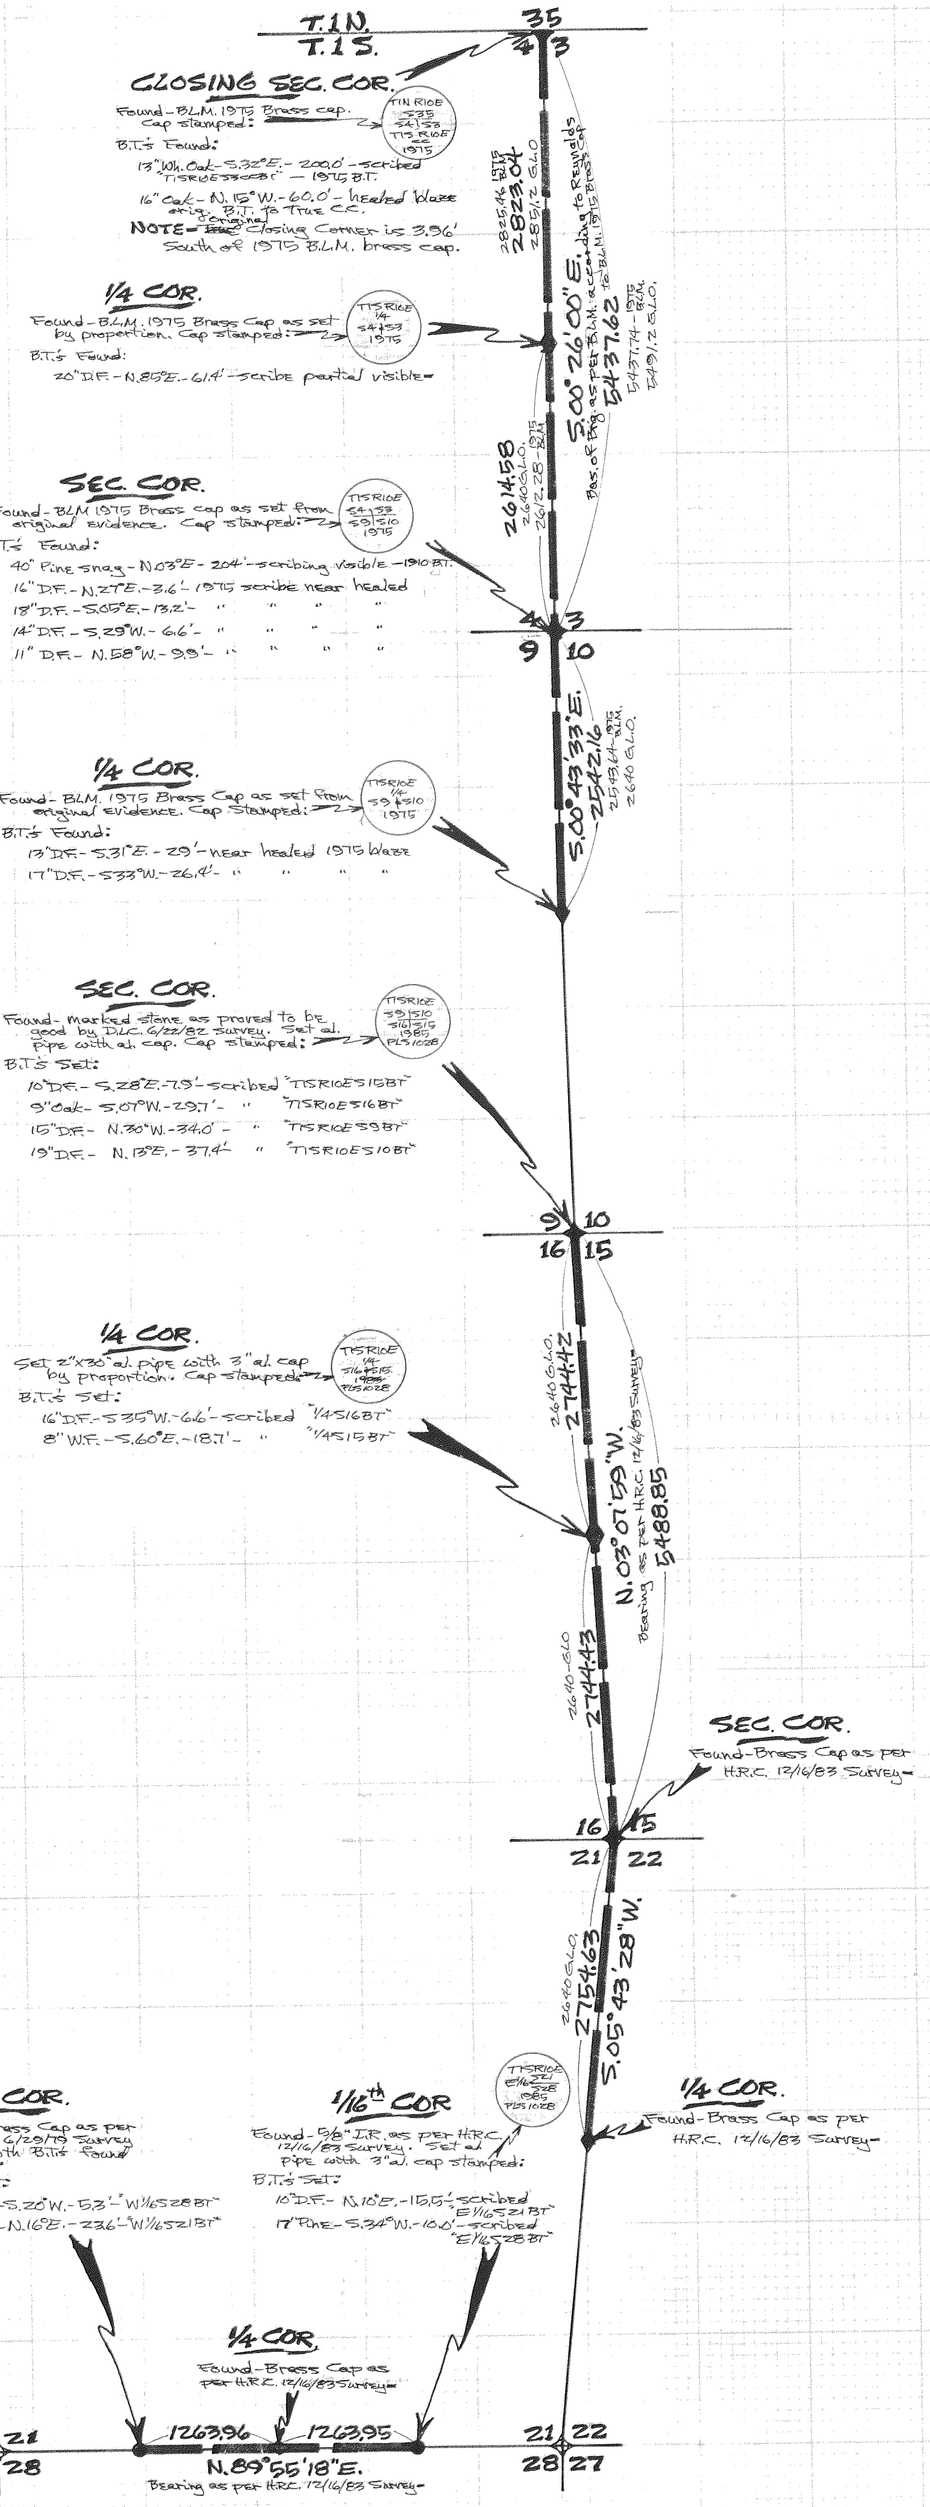

NARRATIVE -

T. 1S., R. 10E., W.M. was subdivided in 1884 by Newton Clark.

On Sept. 17, 1984 the U.S.D.A. Forest Service contracted the survey of several of their holdings within the Hood River Ranger District. This particular survey is of Area #3 of said contracted survey. All field angles were turned with a Wild T-1. All distances were measured with a HP. 3805A. Minimum position closure required was 1:5000. Field notes are contained in D.L.C. Field Book 85-3.

CERTIFICATION -

I, Danny L. Cron, a registered Land Surveyor in the State of Oregon hereby certify that this plat & the notes hereon, or attached, are a correct representation of a survey I performed during 1984 & 1985 for the U.S.D.A. Forest Service in accordance with the statutes of the State of Oregon and with the articles of my contract: Said contract being "Surveyors Ridge Cadastral", contract No. 53-0467-4-00935.

Danny L. Cron

Danny L. Cron - Registered Land Surveyor - Oregon License #1028

POSTING & MONUMENTATION -

1.) POSTING - Lines shown as "U.S.D.A. Forest Service Line Posted" are marked by 6' long orange fiberglass posts marked with U.S.F.S. sign 54-2. Said posts are set a maximum interval of 150' & so as to be intervisible if the ground were cleared. All trees 6" or greater in diameter within 3' of line were blazed; U.S.F.S. trees double blazed & private trees single blazed.

2.) BEARING TREES - Bearing trees set are blazed with a 5"x18" scribed blaze placed as close to the ground as possible with a brass disc stamped "LS 1028" nailed at the bottom of said 5"x18" scribed blaze unless noted. All bearing trees set or found have the following:

a.) A 4½"x5" B.T. tag attached to face @ eye height.
b.) A 7"x10" U.S.F.S. tag warning against destroying attached to back @ eye height.
c.) A 6" red band painted around tree above signs.

3.) CORNER MONUMENTATION - Corner monuments set are 2"x30" aluminum pipes with a stamped 3" aluminum cap affixed. Said 2"x30" pipes are flared at the bottom & are set 24"± in the ground unless noted. At all corner monuments, set or found, a 7"x10" U.S.F.S. tag warning against destroying attached to a orange fiberglass post was set; in addition orange fiberglass posts were set within 3' to 5' of corner on lines posted.

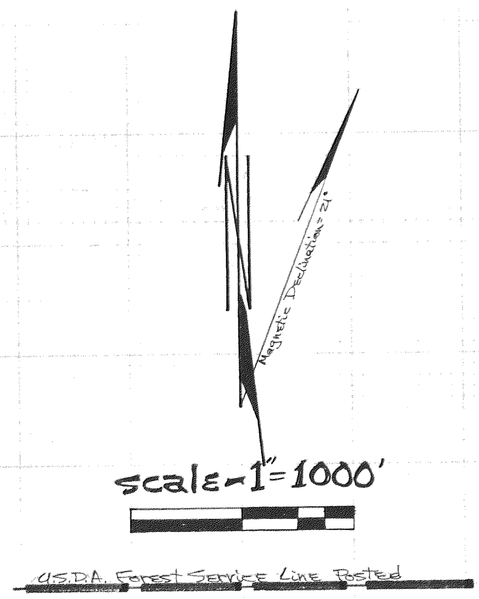

"SURVEY"

FOR - U.S.D.A. Forest Service
LOCATION - Lines located in T. 1S., R. 10E., W.M. -
HOOD RIVER COUNTY, OREGON

D.L.C. Surveying
Dan Cron
5654 Trout Creek Rd.
Parkdale, Ore. 97041

REGISTERED PROFESSIONAL LAND SURVEYOR
Danny L. Cron
OREGON AUGUST 22, 1975 DANNY L. CRON 1028

July 11, 1985

FILED
JUL 12 1985
RICHARD ARNOLD
COUNTY SURVEYOR
By _____ DEPUTY

85034